



Micromega Corporation


Using uM-FPU V3 with the SX Micro and the SX/B compiler

Introduction

The uM-FPU V3 chip is a 32-bit floating point coprocessor that can be easily interfaced with the SX Microcontroller using the SX/B compiler. It provides extensive support for 32-bit IEEE 754 floating point operations and 32-bit long integer operations. The uM-FPU V3 chip supports both I²C and SPI connections.

This document describes how to use the uM-FPU V3 chip with the SX Microcontroller and SX/B compiler. For a full description of the uM-FPU V3 chip, please refer to the *uM-FPU V3 Datasheet* and *uM-FPU V3 Instruction Reference*. Application notes are also available on the Micromega website.

uM-FPU V3 Pin Diagram and Pin Description

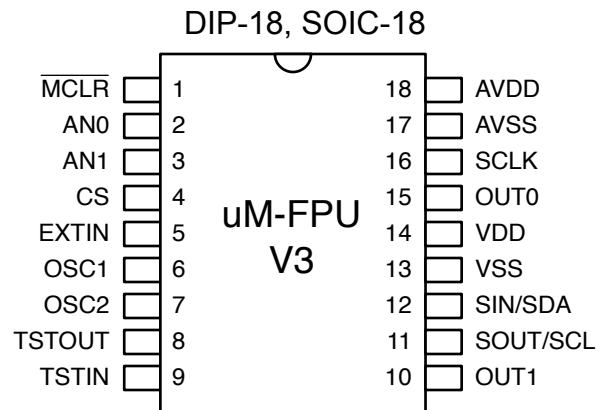

Pin	Name	Type	Description
1	/MCLR	Input	Master Clear (Reset)
2	AN0	Input	Analog Input 0
3	AN1	Input	Analog Input 1
4	CS	Input	Chip Select, Interface Select
5	EXTIN	Input	External Input
6	OSC1	Input	Oscillator Crystal (optional)
7	OSC2	Output	Oscillator Crystal (optional)
8	TSTOUT	Output	Test Output, Debug Monitor - Tx
9	TSTIN	Input	Test Input, Debug Monitor - Rx
10	OUT1	Output	Test Point 1
11	SOUT SCL	Output Input	SPI Output, Busy/Ready Status I ² C Clock
12	SIN/SDA		
13	VSS		
14	VDD		
15	OUT0		
16	SCLK		
17	AVSS		
18	AVDD		

12	SIN SDA	Input In/Out	SPI Input I ² C Data
13	VSS	Power	Digital Ground
14	VDD	Power	Digital Supply Voltage
15	OUT0	Output	Test Point 0
16	SCLK	Input	SPI Clock
17	AVSS	Power	Analog Ground
18	AVDD	Power	Analog Supply Voltage

Connecting uM-FPU V3 to the SX Microcontroller using 2-wire SPI

Only two pins are required for interfacing to the SX Microcontroller to the uM-FPU V3 chip using a 2-wire SPI interface. The communication uses a bidirectional serial interface that requires a clock pin and a data pin. The default settings for these pins are shown below (they can be changed to suit your application):


```

FPU_IN      var    RC.1      ' SPI data input
FPU_OUT     var    RC.1      ' SPI data output
FPU_CLK     var    RC.0      ' SPI clock

```

The FPU_OUT and FPU_IN pins are defined separately in case you want to change to a 3-wire SPI interface. Although the uM-FPU V3 chip supports SPI with chip select, this mode is not used by the current support routines. The support routines assume the uM-FPU V3 chip is always selected, so the FPU_CLK, FPU_IN, and FPU_OUT pins should not be used for other connections as this would likely result in loss of synchronization between the SX Microcontroller and the uM-FPU V3 coprocessor.

SX Microcontroller Pins

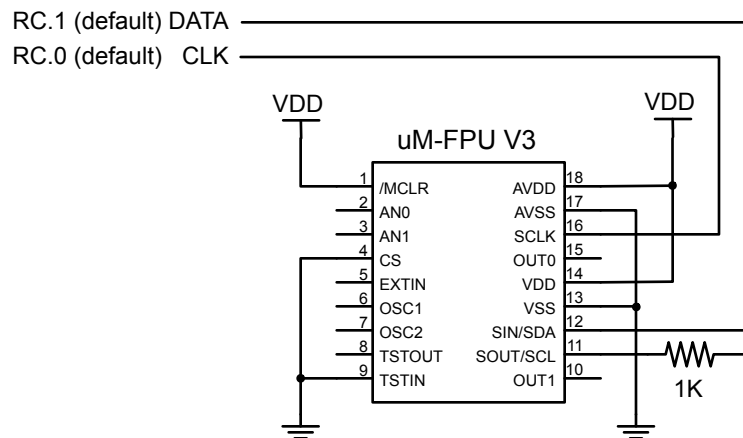

Connecting uM-FPU V3 to the SX Microcontroller using I²C

The uM-FPU V3 can also be connected using an I²C interface. The default slave ID for the uM-FPU is \$C8. The default setting for the I²C pins is shown below (they can be changed to suit your application):


```
SDA      var    RA.0      ' I2C data
SCL      var    RA.1      ' I2C clock
```

SX Microcontroller Pins

RA.1 (default) SCL

RA.0 (default) SDA

Note: SCL and SDA must have pull-up resistors as required by the I²C bus.

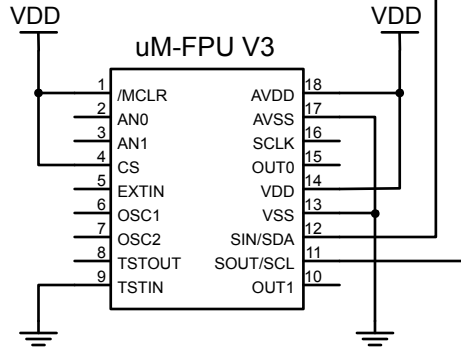

Brief Overview of the uM-FPU V3 chip

For a full description of the uM-FPU V3 chip, please refer to the *uM-FPU V3 Datasheet*, *uM-FPU V3 Instruction Reference*. Application notes are also available on the Micromega website.

The uM-FPU V3 chip is a separate coprocessor with its own set of registers and instructions designed to provide microcontrollers with 32-bit floating point and long integer capabilities. The SX Microcontroller communicates with the uM-FPU using a SPI or I²C interface. Instructions and data are sent to the uM-FPU, and the uM-FPU performs the calculations. The SX Microcontroller is free to do other tasks while the uM-FPU performs calculations. Results can be read back to the SX Microcontroller or stored on the uM-FPU for later use. The uM-FPU V3 chip has 128 registers, numbered 0 through 127, that can hold 32-bit floating point or long integer values. Register 0 is often used as a temporary register and is modified by some of the uM-FPU V3 instructions. Registers 1 through 127 are available for general use.

The `SELECTA` instruction is used to select any one of the 128 registers as register A. Register A can be regarded as an accumulator or working register. Arithmetic instructions use the value in register A as an operand and store the result of the operation in register A. If an instruction requires more than one operand, the additional operand is specified by the instruction. The following example selects register 2 as register A and adds register 5 to it:

```
SELECTA, 2          select register 2 as register A
FSET, 5             register[A] = register[A] + register[5]
```

Sending Instructions to the uM-FPU V3 chip

Appendix A contains a table that gives a summary of each uM-FPU V3 instruction, with enough information to follow the examples in this document. For a detailed description of each instruction, refer to the *uM-FPU V3 Instruction Reference*.

To send instructions to the uM-FPU the `Fpu_StartWrite`, `Fpu_Write`, and `Fpu_Stop` subroutines are used as follows:

```
Fpu_StartWrite
Fpu_Write FADD, 5
Fpu_Stop
```

The `Fpu_StartWrite` and `Fpu_Stop` subroutine calls are used to indicate the start and end of a write transfer. A write transfer will often consist of several instructions and data. Up to 256 bytes can be sent in a single write transfer. If more than 256 bytes are required, the `Fpu_Wait` subroutine must be called to wait for the uM-FPU to be ready before starting another write transfer and sending more instructions and data. In the remainder of this section, the `Fpu_StartWrite` and `Fpu_Stop` will be omitted to simplify the examples. See the sample code for a more complete example.

The `Fpu_Write` subroutine call can have up to four parameters. Each parameter is an 8-bit value that represents an instruction or data to be sent to the uM-FPU. All instructions start with an opcode that tells the uM-FPU which operation to perform. The support files contain definitions for all of the uM-FPU V3 opcodes. Some instructions require additional data or arguments, and some instructions return data. The most common instructions (the ones shown in the first half of the table in Appendix A), require a single byte for the opcode. For example:

```
Fpu_Write FADD, 5
```

All instructions have an opcode that tells the uM-FPU which operation to perform, The following example

calculates the square root of register A:

```
Fpu_Write Sqrt
```

Some instructions require additional operands or data and are specified by the bytes following the opcode. The following example adds register 5 to register A.

```
Fpu_Write FADD, 5
```

Some instructions return data. This example reads the lower 8 bits of register A:

```
Fpu_Write LREBYTE  
n = Fpu_ReadByte
```

The following example adds the value in register 5 to the value in register 2.

```
Fpu_Write SELECTA, 2, FADD, 5
```

It's a good idea to use constant definitions to provide meaningful names for the registers. This makes your program code easier to read and understand. The same example using constant definitions would be:

```
Total      CON 2      ' total amount (uM-FPU register)  
Count      CON 5      ' current count (uM-FPU register)
```

```
Fpu_Write SELECTA, Total, FADD, Count
```

Tutorial Examples

Now that we've introduced some of the basic concepts of sending instructions to the uM-FPU, let's go through a tutorial example to get a better understanding of how it all ties together. This example takes a temperature reading from a DS1620 digital thermometer and converts it to Celsius and Fahrenheit.

Most of the data read from devices connected to the SX Microcontroller will return some type of integer value. In this example, the interface routine for the DS1620 reads a 9-bit value and stores it in a word variable on the SX Microcontroller called `rawTemp`. The value returned by the DS1620 is the temperature in units of 1/2 degrees Celsius. The following instructions load the `rawTemp` value (`rawHigh` is high byte, `rawLow` is low byte) to the uM-FPU, converts the value to floating point, then divides it by 2 to get degrees in Celsius.

```
Fpu_Write SELECTA, DegC
Fpu_Write LOADWORD, rawHigh, rawLow
Fpu_Write FSET0, FDIVI, 2
```

Description:

SELECTA, DegC	select DegC as register A
LOADWORD, rawHigh, rawLow	load rawTemp to register 0 and convert to floating point
FSET0	DegC = register[0] (i.e. the floating point value of rawTemp)
FDIVI, 2	divide by the floating point value 2.0

To get the degrees in Fahrenheit we use the formula $F = C * 1.8 + 32$. Since 1.8 is a floating point constant, it would normally be loaded once in the initialization section of the program and used later in the program. The value 1.8 can be loaded using the ATOF (ASCII to float) instruction as follows:

```
Fpu_Write SELECTA, F1_8, ATOF
Fpu_Write "1", ".", "8", 0
Fpu_Write FSET0
```

Description:

SELECTA, F1.8	select F1_8 as register A
ATOF, "1", ".", "8", 0	load the string 1.8 (note: the string must be zero terminated), convert the string to floating point, and store in register 0
FSET0	F1_8 = register[0] (i.e. 1.8)

We calculate the degrees in Fahrenheit ($DegF = DegC * 1.8 + 32$) as follows:

```
Fpu_Write SELECTA, DegF, FSET, DegC
Fpu_Write FMUL, F1_8, FADDI, 32
```

Description:

SELECTA, DegF	select DegF as register A
FSET, DegC	DegF = DegC
FMUL, F1_8	DegF = DegF * 1.8
FADDI, 32	DegF = DegF + 32.0

Note: this tutorial example is intended to show how to perform a familiar calculation, but the FCNV instruction could be used to perform unit conversions in one step. See the *uM-FPU V3 Instruction Reference* for a full list of conversions.

There are support routines provided for printing floating point and long integer numbers. The `Print_Float`

subroutine is used to convert a floating point value to a formatted string and send it to the serial port. The first parameter selects the uM-FPU register, and the second parameter specifies the desired format. The tens digit is the total number of characters to display, and the ones digit is the number of digits after the decimal point. The DS1620 has a maximum temperature of 125° Celsius and one decimal point of precision, so we'll use a format of 51. The following example prints the temperature in degrees Celsius and degrees Fahrenheit.

```
Print_Float DegC, 51  
Print_Float DegF, 51
```

Sample code for this tutorial and a wiring diagram for the DS1620 are shown at the end of this document. The file *demo1-spi.sxb* is also included with the support software. There is a second file called *demo2-spi.sxb* that extends this demo to include minimum and maximum temperature calculations. If you have a DS1620 you can wire up the circuit and try out the demos.

uM-FPU Support Software for the SX Microcontroller

Two template files contain all of the definitions and support code required for communicating with the uM-FPU V3 chip:

`umfpuV3-spi.sxb` provides support for a 2-wire SPI connection to the uM-FPU V3 chip
`umfpuV3-i2c.sxb` provides support for an I²C connection to the uM-FPU V3 chip

These files can be used directly as the starting point for a new program, or the definitions and support code can be copied to another program. They contain the following:

- pin definitions for the uM-FPU V3
- opcode definitions for all uM-FPU V3 instructions
- various definitions for the word variable used by the support routines
- a sample program with a place to insert your application code
- the support routines described below

The subroutines are the same for the SPI and I²C interface, so user programs can be developed using code that is compatible with either interface.

Fpu_Reset

To ensure that the SX Microcontroller and the uM-FPU coprocessor are synchronized, a reset call must be done at the start of every program. The `Fpu_Reset` routine resets the uM-FPU V3 chip, confirms communications, and returns the sync character \$5C if the reset is successful. A sample reset call is included in the `umfpuV3-spi.sxb` and `umfpuV3-i2c.sxb` files.

Fpu_Wait

The uM-FPU chip must have completed all instructions in the instruction buffer, and be ready to return data, before sending an instruction to read data from the uM-FPU. The `Fpu_Wait` routine checks the status of the uM-FPU and waits until it is ready. The print routines check the ready status, so it isn't necessary to call `Fpu_Wait` before calling a print routine, but if your program reads directly from the uM-FPU using the `Fpu_Read`, `Fpu_ReadWord`, `Fpu_ReadFloat`, or `Fpu_ReadLong` subroutines, a call to `Fpu_Wait` must be made prior to sending the read instruction. An example of reading a byte value is as follows:

```
Fpu_Wait
Fpu_Write LREADBYTE
n = Fpu_Read
```

Description:

- wait for the uM-FPU to be ready
- send the LREADBYTE instruction
- read a byte value

The uM-FPU V3 chip has a 256 byte instruction buffer. In most cases, data will be read back before 256 bytes have been sent to the uM-FPU. If a long calculation is done that requires more than 256 bytes to be sent to the uM-FPU, an `Fpu_Wait` call should be made at least every 256 bytes to ensure that the instruction buffer doesn't overflow.

Fpu_StartWrite

This subroutine is called to start all write transfers.

Fpu_StartRead

This subroutine is called to start all read transfers.

Fpu_Stop

This subroutine is called to stop a write or read transfer. If a read transfer begins immediately after a write transfer, the `Fpu_Stop` is not required. It is also not required if the `Fpu_Wait`, `Print_Float`, or `Print_Long` subroutines are called, since these subroutines call `Fpu_Stop` internally.

Fpu_Write

This subroutine is used to send instructions and data to the uM-FPU. Up to four 8-bit values can be passed as parameters. A `Fpu_StartWrite` call must be made at the start of a write transfer, before the first `Fpu_Write` call is made.

Fpu_Read

This function is used to read 8 bits of data from the uM-FPU. The value is returned in the `dataByte` variable and as the function return value.

Fpu_ReadWord

This function is used to read 16 bits of data from the uM-FPU. The value is returned in the `dataHigh` and `dataLow` variables and as the function return value.

Fpu_ReadFloat

This function is used to read a 32-bit floating point value from the uM-FPU. The 32-bit value is returned as the function return value.

Fpu_ReadLong

This function is used to read a 32-bit long integer value from the uM-FPU. The 32-bit value is returned as the function return value.

Fpu_ReadStatus

The current status byte is read from the uM-FPU and returned in the `STATUS` variable.

Print_Float

The floating point value contained in a uM-FPU register is converted to a formatted string and sent to the serial port. The format parameter is used to specify the desired format. The tens digit specifies the total number of characters to display and the ones digit specifies the number of digits after the decimal point. If the value is too large for the format specified, then asterisks will be displayed. If the number of digits after the decimal points is zero, no decimal point will be displayed. Examples of the display format are as follows:

Value in A register	format	Display format
123.567	61 (6.1)	123.6
123.567	62 (6.2)	123.57
123.567	42 (4.2)	*.*
0.9999	20 (2.0)	1
0.9999	31 (3.1)	1.0

If the format parameter is omitted, or has a value of zero, the default format is used. Up to eight significant digits will be displayed if required. Very large or very small numbers are displayed in exponential notation. The length of the displayed value is variable and can be from 3 to 12 characters in length. The special cases of NaN (Not a Number), +Infinity, -Infinity, and -0.0 are handled. Examples of the display format are as follows:

1.0	NaN	0.0
1.5e20	Infinity	-0.0
3.1415927	-Infinity	1.0

-52.333334 -3.5e-5 0.01

Print_Long

The long integer value contained in a uM-FPU register is converted to a formatted string and sent to the serial port. The format parameter is used to specify the desired format. A value between 0 and 15 specifies the width of the display field for a signed long integer. The number is displayed right justified. If 100 is added to the format value the value is displayed as an unsigned long integer. If the value is larger than the specified width, asterisks will be displayed. If the width is specified as zero, the length will be variable. Examples of the display format are as follows:

Value in register A	format	Display format
-1	10 (signed 10)	-1
-1	110 (unsigned 10)	4294967295
-1	4 (signed 4)	-1
-1	104 (unsigned 4)	****
0	4 (signed 4)	0
0	0 (unformatted)	0
1000	6 (signed 6)	1000

If the format parameter is omitted, or has a value of zero, the default format is used. The displayed value can range from 1 to 11 characters in length. Examples of the display format are as follows:

1
500000
-3598390

Print_Version

This subroutine prints the uM-FPU version string to the serial port.

Print_FpuString

This subroutine is used to read a zero terminated string from the uM-FPU and send it to the serial port. It is used by the `Print_Float`, `Print_Long`, and `Print_Version` routines and is rarely called directly by user code.

Print_String

Sends a zero terminated string to the serial port.

```
Title_str:      data    13, 10, 13, 10, "demo1-spi", 13, 10, 0
```

```
Print_String Title_str    ' print the title string
```

Print_CRLF

Sends a carriage return and linefeed to the serial port.

Print_Byte

Send the 8-bit byte contained to the serial port. If no parameter is passed, the value of the `dataByte` variable is used.

Loading Data Values to the uM-FPU

Most of the data read from devices connected to the SX Microcontroller will return some type of integer value. There are several ways to load integer values to the uM-FPU and convert them to 32-bit floating point or long integer values.

8-bit Integer to Floating Point

The `FSETI`, `FADDI`, `FSUBI`, `FSUBRI`, `FMULI`, `FDIVI`, `FDIVRI`, `FPOWI`, and `FCMPI` instructions read the byte following the opcode as an 8-bit signed integer, convert the value to floating point, and then perform the operation. It's a convenient way to work with constants or data values that are signed 8-bit values. The following example stores the byte variable `dataByte` to the `Result` register on the uM-FPU.

```
Fpu_Write SELECTA, Result, FSETI, dataByte
```

The `LOADBYTE` instruction reads the byte following the opcode as an 8-bit signed integer, converts the value to floating point, and stores the result in register 0.

The `LOADUBYTE` instruction reads the byte following the opcode as an 8-bit unsigned integer, converts the value to floating point, and stores the result in register 0.

16-bit Integer to Floating Point

The `LOADWORD` instruction reads the two bytes following the opcode as a 16-bit signed integer (MSB first), converts the value to floating point, and stores the result in register 0. The following example adds the word variable `dataWord` to the `Result` register on the uM-FPU (`dataHigh` is the high byte and `dataLow` is the low byte of `dataWord`).

```
Fpu_Write SELECTA, Result  
Fpu_Write LOADWORD, dataHigh, dataLow, FADD0
```

The `LOADUWORD` instruction reads the two bytes following the opcode as a 16-bit unsigned integer (MSB first), converts the value to floating point, and stores the result in register 0.

Floating Point

The `FWRITE`, `FWRITEA`, `FWRITEEX`, and `FWRITE0` instructions read the four bytes following the opcode as a 32-bit floating point value and stores it in the specified register. This is one of the more efficient ways to load floating point constants, but requires knowledge of the internal representation for floating point numbers (see Appendix B). The *uM-FPU V3 IDE* can be used to easily generate the 32-bit values. This example sets `Angle = 20.0` (the floating point representation for 20.0 is `$41A00000`).

```
Fpu_Write FWRITE, Angle  
Fpu_Write $41, $A0, $00, $00
```

ASCII string to Floating Point

The `ATOF` instruction is used to convert strings to floating point values. The instruction reads the bytes following the opcode (until a zero terminator is read), converts the string to floating point, and stores the result in register 0. For example, to set `Angle = 1.5885`:

```
Fpu_Write SELECTA, Angle, ATOF  
Fpu_Write "1", ".", "5", "8"  
Fpu_Write "8", "5", 0, FSET0
```

8-bit Integer to Long Integer

The `LSETI`, `LADDI`, `LSUBI`, `LMULI`, `LDIVI`, `LCMPI`, `LUDIVI`, `LUCMPI`, and `LTSTI` instructions read the byte

following the opcode as an 8-bit signed integer, convert the value to long integer, and then perform the operation. It's a convenient way to work with constants or data values that are signed 8-bit values. The following example adds the byte variable `dataByte` to the `Total` register on the uM-FPU.

```
Fpu_Write SELECTA, Total, LADDI, dataByte
```

The `LONGBYTE` instruction reads the byte following the opcode as an 8-bit signed integer, converts the value to long integer, and stores the result in register 0.

The `LONGUBYTE` instruction reads the byte following the opcode as an 8-bit unsigned integer, converts the value to long integer, and stores the result in register 0.

16-bit Integer to Long Integer

The `LONGWORD` instruction reads the two bytes following the opcode as a 16-bit signed integer (MSB first), converts the value to long integer, and stores the result in register 0. The following example adds the word variable `dataWord` to the `Total` register on the uM-FPU.

```
Fpu_Write SELECTA, Total  
Fpu_Write LONGWORD, dataHigh, dataLow, LADD0
```

The `LONGUWORD` instruction reads the two bytes following the opcode as a 16-bit unsigned integer (MSB first), converts the value to long integer, and stores the result in register 0.

Long Integer

The `LWRITE`, `LWRITEA`, `LWRITEX`, and `LWRITE0` instructions read the four bytes following the opcode as a 32-bit long integer value and stores it in the specified register. This is used to load integer values greater than 16 bits. The *uM-FPU V3 IDE* can be used to easily generate the 32-bit values. For example, to set `Total = 500000`:

```
Fpu_Write LWRITE, Total, $00, $07, $A1, $20
```

ASCII string to Long Integer

The `ATOL` instruction is used to convert strings to long integer values. The instruction reads the bytes following the opcode (until a zero terminator is read), converts the string to long integer, and stores the result in register 0. For example, to set `Total = 500000`:

```
Fpu_Write SELECTA, Total, ATOL  
Fpu_Write "5", "0", "0", "0"  
Fpu_Write "0", "0", "0", 0  
Fpu_Write FSET0
```

The fastest operations occur when the uM-FPU registers are already loaded with values. In time critical portions of code floating point constants should be loaded beforehand to maximize the processing speed in the critical section. With 128 registers available on the uM-FPU, it's often possible to pre-load all of the required constants. In non-critical sections of code, data and constants can be loaded as required.

Reading Data Values from the uM-FPU

The uM-FPU V3 has a 256 byte instruction buffer which allows data transmission to continue while previous instructions are being executed. Before reading data, you must check to ensure that the previous commands have completed, and the uM-FPU is ready to send data. The `Fpu_Wait` routine is used to wait until the uM-FPU is ready, then a read command is sent, and the `readByte`, `readWord`, `readFloat`, or `readLong` subroutines are called to read data.

Floating Point

The FREAD, FREADA, FREADX, and FREAD0 instructions read four bytes from the uM-FPU as a 32-bit floating point value. The following example reads the 32-bit floating point value from register A and stores it in byte array variable `floatVal(4)`.

```
Fpu_Wait
Fpu_StartWrite
Fpu_Write FREADA
floatVal = Fpu_ReadFloat
```

Floating Point to ASCII string

The FTOA instruction can be used to convert floating point values to an ASCII string. The `Print_Float` routine uses this instruction to read the floating point value from register A and display it on the PC screen.

8-bit Integer

The LREADBYTE instruction reads the lower 8 bits from register A. The following example stores the lower 8 bits of register A in byte variable `byteVal`.

```
Fpu_Wait
Fpu_StartWrite
Fpu_Write LREADBYTE
byteVal = Fpu_Read
```

16-bit Integer

The LREADWORD instruction reads the lower 16 bits from register A. The following example stores the lower 16 bits of register A in word variable `dataWord`.

```
Fpu_Wait
Fpu_StartWrite
Fpu_Write LREADWORD
byteVal = Fpu_ReadWord
```

Long Integer

The LREAD, LREADA, LREADX, and LREAD0 instructions read four bytes from the uM-FPU as a 32-bit long integer value. The following example reads the 32-bit long integer value from register A and stores it in byte array variable `longVal(4)`.

```
Fpu_Wait
Fpu_StartWrite
Fpu_Write LREADA
longVal = Fpu_ReadLong
```

Long Integer to ASCII string

The LTOA instruction can be used to convert long integer values to an ASCII string. The `Print_Long` and `Print_LongFormat` routines use this instruction to read the long integer value from register A and display it on the PC screen.

Comparing and Testing Floating Point Values

Floating point values can be zero, positive, negative, infinite, or Not a Number (which occurs if an invalid operation is performed on a floating point value). The status byte is read using the `Fpu_Status` routine. It waits for the uM-FPU to be ready before sending the READSTATUS command and reading the status. The current status is returned in the `status` variable. Bit definitions are provided for the status bits in the `status` variable as follows:

<code>status_Zero</code>	Zero status bit (0-not zero, 1-zero)
<code>status_Sign</code>	Sign status bit (0-positive, 1-negative)
<code>status_NaN</code>	Not a Number status bit (0-valid number, 1-NaN)
<code>status_Inf</code>	Infinity status bit (0-not infinite, 1-infinite)

The `FSTATUS` and `FSTATUSA` instructions are used to set the status byte to the floating point status of the selected register. The following example checks the floating point status of register A:

```
Fpu_Write Fpu_FSTATUSA
Fpu_ReadStatus
if status_Zero <> 0 then
    ' Result is Zero
endif
if status_Sign <> 0
    ' Result is Negative
endif
```

The `FCMP`, `FCMP0`, and `FCMPI` instructions are used to compare two floating point values. The status bits are set for the result of register A minus the operand (the selected registers are not modified). For example, to compare register A to the value 10.0:

```
Fpu_Write Fpu_FCMPI, 10
Fpu_ReadStatus
if status_Zero <> 0 then
    ' Value1 = Value2
else
    if status_Sign != 0 then
        ' Value < Value2
    else
        ' Value1 > Value2
    endif
endif
endif
```

The `FCMP2` instruction compares two floating point registers. The status bits are set for the result of the first register minus the second register (the selected registers are not modified). For example, to compare registers `Value1` and `Value2`:

```
Fpu_Write FCMP2, Value1, Value2
Fpu_ReadStatus
```

Comparing and Testing Long Integer Values

A long integer value can be zero, positive, or negative. The status byte is read using the `Fpu_Status` routine. It waits for the uM-FPU to be ready before sending the `READSTATUS` command and reading the status. The current status is returned in the `status` variable. Bit definitions are provided for the status bits in the `status` variable as follows:

<code>status_Zero</code>	Zero status bit (0-not zero, 1-zero)
<code>status_Sign</code>	Sign status bit (0-positive, 1-negative)

The `LSTATUS` and `LSTATUSA` instructions are used to set the status byte to the long integer status of the selected register. The following example checks the long integer status of register A:

```
Fpu_Write Fpu_LSTATUSA
Fpu_ReadStatus
```

```

if status_Zero <> 0 then
  ' Result is Zero
endif
if status_Sign <> 0
  ' Result is Negative
endif

```

The LCMP, LCMP0, and LCMP1 instructions are used to do a signed comparison of two long integer values. The status bits are set for the result of register A minus the operand (the selected registers are not modified). For example, to compare register A to the value 10:

```

Fpu_Write Fpu_LCMP1, 10
Fpu_ReadStatus
if status_Zero <> 0 then
  ' Value1 = Value2
else
  if status_Sign != 0 then
    ' Value < Value2
  else
    ' Value1 > Value2
  endif
endif
endif

```

The LCMP2 instruction does a signed compare of two long integer registers. The status bits are set for the result of the first register minus the second register (the selected registers are not modified). For example, to compare registers Value1 and Value2:

```

Fpu_Write LCMP2, Value1, Value2
Fpu_ReadStatus

```

The LUCMP, LUCMP0, and LUCMP1 instructions are used to do an unsigned comparison of two long integer values. The status bits are set for the result of register A minus the operand (the selected registers are not modified).

The LUCMP2 instruction does an unsigned compare of two long integer registers. The status bits are set for the result of the first register minus the second register (the selected registers are not modified).

The LTST, LTST0 and LTST1 instructions are used to do a bit-wise compare of two long integer values. The status bits are set for the logical AND of register A and the operand (the selected registers are not modified).


Further Information

The following documents are also available:

<i>uM-FPU V3 Datasheet</i>	provides hardware details and specifications
<i>uM-FPU V3 Instruction Reference</i>	provides detailed descriptions of each instruction
<i>uM-FPU Application Notes</i>	various application notes and examples

Check the Micromega website at www.micromegacorp.com for up-to-date information.

DS1620 Connections for Demo 1

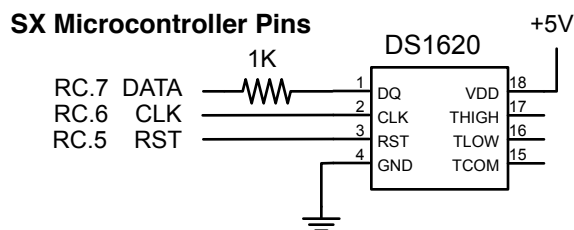

Sample Code for Tutorial (demo1-spi.sxb)

```
' This program demonstrates how to use the uM-FPU V3 floating point coprocessor
' connected to the SX Microcontroller over an 2-wire SPI interface. It takes
' temperature readings from a DS1620 digital thermometer, converts them to
' floating point and displays them in degrees Celsius and degrees Fahrenheit.
```

```
'=====
'----- uM-FPU V3 SPI definitions ----- 2006-10-25
'=====
```

```
'----- uM-FPU V3 pin definitions -----
```

```
FPU_IN          var    RC.1          ' SPI data input
FPU_OUT         var    RC.1          ' SPI data output
FPU_CLK        var    RC.0          ' SPI clock
```

```
'----- serial I/O pin definitions -----
```

```
SerialIn       var    RA.2          ' serial input
SerialOut      var    RA.3          ' serial output
```

```
'----- constant definitions -----
```

```
Baud           con    "T9600"      ' 9600 baud, non-inverted
```

```
'----- uM-FPU V3 opcodes -----
```

```
SELECTA       CON    $01          ' Select register A
ATOF          CON    $1E          ' Convert ASCII to float, store in reg[0]
FTOA         CON    $1F          ' Convert float to ASCII
FSET         CON    $20          ' reg[A] = reg[nn]
FMUL         CON    $24          ' reg[A] = reg[A] * reg[nn]
FSET0        CON    $29          ' reg[A] = reg[0]
FADDI        CON    $33          ' reg[A] = reg[A] + float(bb)
FDIVI        CON    $37          ' reg[A] = reg[A] / float(bb)
LOADWORD     CON    $5B          ' reg[0] = float(signed word)
LTOA         CON    $9B          ' Convert long integer to ASCII
SYNC         CON    $F0          ' Get synchronization byte
READSTATUS   CON    $F1          ' Read status byte
READSTR      CON    $F2          ' Read string from string buffer
VERSION      CON    $F3          ' Copy version string to string buffer
```



```

SyncChar      CON      $5C      ' sync character

'----- uM-FPU variables -----

dataWord      var      byte(2)    ' data word
dataHigh      var      dataWord(1) ' high byte of dataWord
dataLow       var      dataWord(0) ' low byte of dataWord
dataByte      var      dataWord(0) ' alternate name for dataLow
status_Zero   var      dataByte.0  ' Zero status bit (0-not zero, 1-zero)
status_Sign   var      dataByte.1  ' Sign status bit (0-positive, 1-negative)
status_NaN    var      dataByte.2  ' Not a Number status bit (0-valid number, 1-NaN)
status_Inf    var      dataByte.3  ' Infinity status bit (0-not infinite, 1-infinite)

idx           var      word        ' temporary index
tmpCnt        var      byte        ' parameter count
tmp1          var      byte        ' temporary subroutine values
tmp2          var      byte
tmp3          var      byte
tmp4          var      byte
tmpWord       var      word
reg           var      byte        ' register value
format        var      byte        ' print format
opcode        var      byte        ' opcode

watch dataWord, 16, uhex
watch dataByte, 8, uhex

'===== end of uM-FPU V3 SPI definitions =====

rawTemp       var      byte(2)    ' raw temperature
rawHigh       var      rawTemp(1)
rawLow        var      rawTemp(0)

'----- DS1620 pin definitions -----

DS_RST        var      RC.5        ' DS1620 reset/enable
DS_CLK        var      RC.6        ' DS1620 clock
DS_DATA       var      RC.7        ' DS1620 data

'----- uM-FPU register definitions -----

DegC          con      1           ' degrees Celsius
DegF          con      2           ' degrees Fahrenheit
Fl_8          con      3           ' constant 1.8

'-----
INTERRUPT
'-----

ISR_Start:
  ' ISR code here

ISR_Exit:
  RETURNINT ' {cycles}

'=====
PROGRAM Start
'=====

```

```

-----
' Subroutine Declarations
-----

```

```

Init_DS1620      sub    0
Read_DS162      sub    0
Shiftout_DS1620 sub    1

Fpu_Reset       sub    0
Fpu_StartWrite  sub    0
Fpu_StartRead   sub    0
Fpu_Stop        sub    0
Fpu_Write       sub    1, 4
Fpu_Read        func   1, 0
Fpu_ReadWord    func   2, 0
Fpu_ReadFloat   func   4, 0
Fpu_ReadLong    func   4, 0
Fpu_Wait        sub    0

SPI_Write       sub    1
SPI_Read        sub    0

Print_Version   sub    0
Print_Float     sub    0, 2
Print_Long      sub    0, 2
Print_FpuString sub    0
Print_String    sub    2
Print_CRLF      sub    0
Print_Byte      sub    0, 1

```

```

----- Strings -----

```

```

Title_str:
      data 13, 10, 13, 10, "demo1-spi", 13, 10, 0
NotFound_str:
      data "uM-FPU V3 not found", 0
Done_str:
      data 13, 10, "Done.", 13, 10, 0
DegC_str:
      data 13, 10, 13, 10, "Degrees C: ", 0
DegF_str:
      data 13, 10, "Degrees F: ", 0

```

```

=====
'----- initialization -----
=====

```

```

Start:
  Print_String Title_str      ' print program title

  Fpu_Reset                   ' reset the uM-FPU

  if dataByte = SyncChar then ' check for synchronization
    Print_Version
  else
    Print_String NotFound_str
    goto Done

```

```

endif

Init_DS1620                ' initialize DS1620

Fpu_StartWrite             ' load constant 1.8
Fpu_Write SELECTA, F1_8, ATOF
Fpu_Write "1", ".", "8", 0
Fpu_Write FSET0
Fpu_Stop

'=====
'----- main routine -----
'=====

Main:

' get temperature reading from DS1620
Read_DS1620

' send raw temperature to uM-FPU V3
' convert to floating point
' divide by 2 to get degrees Celsius
Fpu_StartWrite
Fpu_Write SELECTA, DegC
Fpu_Write LOADWORD, rawHigh, rawLow
Fpu_Write FSET0, FDIVI, 2

' degF = degC * 1.8 + 32
Fpu_Write SELECTA, DegF, FSET, DegC
Fpu_Write FMUL, F1_8, FADDI, 32

' display degrees Celsius
Print_String DegC_str
Print_Float DegC, 51

' display degrees Fahrenheit
Print_String DegF_str
Print_Float DegF, 51

' delay 2 seconds, then get the next reading
pause 2000
goto Main

Done:
Print_String Done_str      ' print done message

Doneloop:
goto DoneLoop             ' loop forever

'----- Init_DS1620 -----
' Init_1620
' Initialize the DS1620.
'-----

Init_DS1620:
low DS_RST                ' initialize pin states
high DS_CLK
pause 100

```

```

DS_RST = 1                ' configure for CPU control
Shiftout_DS1620 $0C
Shiftout_DS1620 $02
DS_RST = 0
pause 100

DS_RST = 1                ' wait for first conversion
Shiftout_DS1620 $EE
DS_RST = 0
pause 1000
return

'----- Read_1620 -----
' Read_DS1620
' Returns the raw temperature in the dataWord variable.
'-----

Read_DS1620:
DS_RST = 1                ' read temperature value
Shiftout_DS1620 $AA
shiftdin DS_DATA, DS_CLK, LSBPOST, rawLow
shiftdin DS_DATA, DS_CLK, LSBPOST, rawHigh\1
DS_RST = 0

IF rawHigh.0 = 1 THEN    ' extend the sign bit
    rawHigh = $FF
endif
return

Shiftout_DS1620:
    tmp1 = __PARAM1
    shiftout DS_DATA, DS_CLK, LSBFIRST, tmp1
return

'=====
'----- uM-FPU V3 SPI support routines ----- 2006-10-25
'=====

(see dem01-spi.sxb for full listing)

```

Appendix A

uM-FPU V3 Instruction Summary

Instruction	Opcode	Arguments	Returns	Description
NOP	00			No Operation
SELECTA	01	nn		Select register A
SELECTX	02	nn		Select register X
F CLR	03	nn		reg[nn] = 0
CLRA	04			reg[A] = 0
CLR X	05			reg[X] = 0, X = X + 1
CLR0	06			reg[nn] = reg[0]
COPY	07	mm, nn		reg[nn] = reg[mm]
COPYA	08	nn		reg[nn] = reg[A]
COPYX	09	nn		reg[nn] = reg[X], X = X + 1
F LOAD	0A	nn		reg[0] = reg[nn]
LOADA	0B			reg[0] = reg[A]
LOADX	0C			reg[0] = reg[X], X = X + 1
ALOADX	0D			reg[A] = reg[X], X = X + 1
XSAVE	0E	nn		reg[X] = reg[nn], X = X + 1
XSAVEA	0F			reg[X] = reg[A], X = X + 1
COPY0	10	nn		reg[nn] = reg[0]
COPYI	11	bb, nn		reg[nn] = long(unsigned byte bb)
F SWAP	12	nn, mm		Swap reg[nn] and reg[mm]
SWAPA	13	nn		Swap reg[nn] and reg[A]
LEFT	14			Left parenthesis
RIGHT	15			Right parenthesis
FWRITE	16	nn, b1, b2, b3, b4		Write 32-bit floating point to reg[nn]
FWRITEA	17	b1, b2, b3, b4		Write 32-bit floating point to reg[A]
FWRITE X	18	b1, b2, b3, b4		Write 32-bit floating point to reg[X]
FWRITE0	19	b1, b2, b3, b4		Write 32-bit floating point to reg[0]
FREAD	1A	nn	b1, b2, b3, b4	Read 32-bit floating point from reg[nn]
FREADA	1B		b1, b2, b3, b4	Read 32-bit floating point from reg[A]
FREADX	1C		b1, b2, b3, b4	Read 32-bit floating point from reg[X]
FREAD0	1C		b1, b2, b3, b4	Read 32-bit floating point from reg[0]
ATOF	1E	aa...00		Convert ASCII to floating point
FTOA	1F	bb		Convert floating point to ASCII
FSET	20	nn		reg[A] = reg[nn]
FADD	21	nn		reg[A] = reg[A] + reg[nn]
FSUB	22	nn		reg[A] = reg[A] - reg[nn]
FSUBR	23	nn		reg[A] = reg[nn] - reg[A]
FMUL	24	nn		reg[A] = reg[A] * reg[nn]
FDIV	25	nn		reg[A] = reg[A] / reg[nn]
FDIVR	26	nn		reg[A] = reg[nn] / reg[A]
FPOW	27	nn		reg[A] = reg[A] ** reg[nn]
FCMP	28	nn		Compare reg[A], reg[nn], Set floating point status
FSET0	29			reg[A] = reg[0]
FADD0	2A			reg[A] = reg[A] + reg[0]

FSUB0	2B			$\text{reg}[A] = \text{reg}[A] - \text{reg}[0]$
FSUBR0	2C			$\text{reg}[A] = \text{reg}[0] - \text{reg}[A]$
FMUL0	2D			$\text{reg}[A] = \text{reg}[A] * \text{reg}[0]$
FDIV0	2E			$\text{reg}[A] = \text{reg}[A] / \text{reg}[0]$
FDIVR0	2F			$\text{reg}[A] = \text{reg}[0] / \text{reg}[A]$
FPOW0	30			$\text{reg}[A] = \text{reg}[A] ** \text{reg}[0]$
FCMP0	31			Compare $\text{reg}[A]$, $\text{reg}[0]$, Set floating point status
FSETI	32	bb		$\text{reg}[A] = \text{float}(bb)$
FADDI	33	bb		$\text{reg}[A] = \text{reg}[A] - \text{float}(bb)$
FSUBI	34	bb		$\text{reg}[A] = \text{reg}[A] - \text{float}(bb)$
FSUBRI	35	bb		$\text{reg}[A] = \text{float}(bb) - \text{reg}[A]$
FMULI	36	bb		$\text{reg}[A] = \text{reg}[A] * \text{float}(bb)$
FDIVI	37	bb		$\text{reg}[A] = \text{reg}[A] / \text{float}(bb)$
FDIVRI	38	bb		$\text{reg}[A] = \text{float}(bb) / \text{reg}[A]$
FPOWI	39	bb		$\text{reg}[A] = \text{reg}[A] ** bb$
FCMPI	3A	bb		Compare $\text{reg}[A]$, $\text{float}(bb)$, Set floating point status
FSTATUS	3B	nn		Set floating point status for $\text{reg}[nn]$
FSTATUSA	3C			Set floating point status for $\text{reg}[A]$
FCMP2	3D	nn, mm		Compare $\text{reg}[nn]$, $\text{reg}[mm]$ Set floating point status
FNEG	3E			$\text{reg}[A] = -\text{reg}[A]$
FABS	3F			$\text{reg}[A] = \text{reg}[A] $
FINV	40			$\text{reg}[A] = 1 / \text{reg}[A]$
SQRT	41			$\text{reg}[A] = \text{sqrt}(\text{reg}[A])$
ROOT	42	nn		$\text{reg}[A] = \text{root}(\text{reg}[A], \text{reg}[nn])$
LOG	43			$\text{reg}[A] = \text{log}(\text{reg}[A])$
LOG10	44			$\text{reg}[A] = \text{log}_{10}(\text{reg}[A])$
EXP	45			$\text{reg}[A] = \text{exp}(\text{reg}[A])$
EXP10	46			$\text{reg}[A] = \text{exp}_{10}(\text{reg}[A])$
SIN	47			$\text{reg}[A] = \text{sin}(\text{reg}[A])$
COS	48			$\text{reg}[A] = \text{cos}(\text{reg}[A])$
TAN	49			$\text{reg}[A] = \text{tan}(\text{reg}[A])$
ASIN	4A			$\text{reg}[A] = \text{asin}(\text{reg}[A])$
ACOS	4B			$\text{reg}[A] = \text{acos}(\text{reg}[A])$
ATAN	4C			$\text{reg}[A] = \text{atan}(\text{reg}[A])$
ATAN2	4D	nn		$\text{reg}[A] = \text{atan}_{2}(\text{reg}[A], \text{reg}[nn])$
DEGREES	4E			$\text{reg}[A] = \text{degrees}(\text{reg}[A])$
RADIANS	4F			$\text{reg}[A] = \text{radians}(\text{reg}[A])$
FMOD	50	nn		$\text{reg}[A] = \text{reg}[A] \text{ MOD } \text{reg}[nn]$
FLOOR	51			$\text{reg}[A] = \text{floor}(\text{reg}[A])$
CEIL	52			$\text{reg}[A] = \text{ceil}(\text{reg}[A])$
ROUND	53			$\text{reg}[A] = \text{round}(\text{reg}[A])$
FMIN	54	nn		$\text{reg}[A] = \text{min}(\text{reg}[A], \text{reg}[nn])$
FMAX	55	nn		$\text{reg}[A] = \text{max}(\text{reg}[A], \text{reg}[nn])$
FCNV	56	bb		$\text{reg}[A] = \text{conversion}(bb, \text{reg}[A])$
FMAC	57	nn, mm		$\text{reg}[A] = \text{reg}[A] + (\text{reg}[nn] * \text{reg}[mm])$
FMSC	58	nn, mm		$\text{reg}[A] = \text{reg}[A] - (\text{reg}[nn] * \text{reg}[mm])$

LOADBYTE	59	bb		reg[0] = float(signed bb)
LOADUBYTE	5A	bb		reg[0] = float(unsigned byte)
LOADWORD	5B	b1, b2		reg[0] = float(signed b1*256 + b2)
LOADUWORD	5C	b1, b2		reg[0] = float(unsigned b1*256 + b2)
LOADE	5D			reg[0] = 2.7182818
LOADPI	5E			reg[0] = 3.1415927
LOADCON	5F	bb		reg[0] = float constant(bb)
FLOAT	60			reg[A] = float(reg[A])
FIX	61			reg[A] = fix(reg[A])
FIXR	62			reg[A] = fix(round(reg[A]))
FRAC	63			reg[A] = fraction(reg[A])
FSPLIT	64			reg[A] = integer(reg[A]), reg[0] = fraction(reg[A])
SELECTMA	65	nn, b1, b2		Select matrix A
SELECTMB	66	nn, b1, b2		Select matrix B
SELECTMC	67	nn, b1, b2		Select matrix C
LOADMA	68	b1, b2		reg[0] = Matrix A[bb, bb]
LOADMB	69	b1, b2		reg[0] = Matrix B[bb, bb]
LOADMC	6A	b1, b2		reg[0] = Matrix C[bb, bb]
SAVEMA	6B	b1, b2		Matrix A[bb, bb] = reg[A]
SAVEMB	6C	b1, b2		Matrix B[bb, bb] = reg[A]
SAVEMC	6D	b1, b2		Matrix C[bb, bb] = reg[A]
MOP	6E	bb		Matrix/Vector operation
LOADIND	7A	nn		reg[0] = reg[reg[nn]]
SAVEIND	7B	nn		reg[reg[nn]] = reg[A]
INDA	7C	nn		Select register A using value in reg[nn]
INDX	7D	nn		Select register X using value in reg[nn]
FCALL	7E	fn		Call user-defined function in Flash
EECALL	7F	fn		Call user-defined function in EEPROM
F_RET	80			Return from user-defined function
BRA	81	bb		Unconditional branch
BRA, cc	82	cc, bb		Conditional branch
F JMP	83	b1, b2		Unconditional jump
JMP, cc	84	cc, b1, b2		Conditional jump
TABLE	85	tc, t0...tn		Table lookup
FTABLE	86	cc, tc, t0...tn		Floating point reverse table lookup
LTABLE	87	cc, tc, t0...tn		Long integer reverse table lookup
POLY	88	tc, t0...tn		reg[A] = nth order polynomial
GOTO	89	nn		Computed GOTO
LWRITE	90	nn, b1, b2, b3, b4		Write 32-bit long integer to reg[nn]
LWRITEA	91	b1, b2, b3, b4		Write 32-bit long integer to reg[A]
LWRITEX	92	b1, b2, b3, b4		Write 32-bit long integer to reg[X], X = X + 1
LWRITE0	93	b1, b2, b3, b4		Write 32-bit long integer to reg[0]
LREAD	94	nn	b1, b2, b3, b4	Read 32-bit long integer from reg[nn]
LREADA	95		b1, b2, b3, b4	Read 32-bit long value from reg[A]
LREADX	96		b1, b2, b3, b4	Read 32-bit long integer from reg[X], X = X + 1
LREAD0	97		b1, b2, b3, b4	Read 32-bit long integer from reg[0]

LREBYTE	98		bb	Read lower 8 bits of reg[A]
LREADWORD	99		b1 , b2	Read lower 16 bits reg[A]
ATOL	9A	aa...00		Convert ASCII to long integer
LTOA	9B	bb		Convert long integer to ASCII
LSET	9C	nn		reg[A] = reg[nn]
LADD	9D	nn		reg[A] = reg[A] + reg[nn]
LSUB	9E	nn		reg[A] = reg[A] - reg[nn]
LMUL	9F	nn		reg[A] = reg[A] * reg[nn]
LDIV	A0	nn		reg[A] = reg[A] / reg[nn] reg[0] = remainder
LCMP	A1	nn		Signed compare reg[A] and reg[nn], Set long integer status
LUDIV	A2	nn		reg[A] = reg[A] / reg[nn] reg[0] = remainder
LUCMP	A3	nn		Unsigned compare reg[A] and reg[nn], Set long integer status
LTST	A4	nn		Test reg[A] AND reg[nn], Set long integer status
LSET0	A5			reg[A] = reg[0]
LADD0	A6			reg[A] = reg[A] + reg[0]
LSUB0	A7			reg[A] = reg[A] - reg[0]
LMUL0	A8			reg[A] = reg[A] * reg[0]
LDIV0	A9			reg[A] = reg[A] / reg[0] reg[0] = remainder
LCMP0	AA			Signed compare reg[A] and reg[0], set long integer status
LUDIV0	AB			reg[A] = reg[A] / reg[0] reg[0] = remainder
LUCMP0	AC			Unsigned compare reg[A] and reg[0], Set long integer status
LTST0	AD			Test reg[A] AND reg[0], Set long integer status
LSETI	AE	bb		reg[A] = long(bb)
LADDI	AF	bb		reg[A] = reg[A] + long(bb)
LSUBI	B0	bb		reg[A] = reg[A] - long(bb)
LMULI	B1	bb		reg[A] = reg[A] * long(bb)
LDIVI	B2	bb		reg[A] = reg[A] / long(bb) reg[0] = remainder
LCMPI	B3	bb		Signed compare reg[A] - long(bb), Set long integer status
LUDIVI	B4	bb		reg[A] = reg[A] / unsigned long(bb) reg[0] = remainder
LUCMPI	B5	bb		Unsigned compare reg[A] and long(bb), Set long integer status
LTSTI	B6	bb		Test reg[A] AND long(bb), Set long integer status
LSTATUS	B7	nn		Set long integer status for reg[nn]
LSTATUSA	B8			Set long integer status for reg[A]
LCMP2	B9	nn , mm		Signed long compare reg[nn], reg[mm] Set long integer status

LUCMP2	BA	nn, mm		Unsigned long compare reg[nn], reg[mm] Set long integer status
LNEG	BB			reg[A] = -reg[A]
LABS	BC			reg[A] = reg[A]
LINC	BD	nn		reg[nn] = reg[nn] + 1, set status
LDEC	BE	nn		reg[nn] = reg[nn] - 1, set status
LNOT	BF			reg[A] = NOT reg[A]
LAND	C0	nn		reg[A] = reg[A] AND reg[nn]
LOR	C1	nn		reg[A] = reg[A] OR reg[nn]
LXOR	C2	nn		reg[A] = reg[A] XOR reg[nn]
LSHIFT	C3	nn		reg[A] = reg[A] shift reg[nn]
LMIN	C4	nn		reg[A] = min(reg[A], reg[nn])
LMAX	C5	nn		reg[A] = max(reg[A], reg[nn])
LONGBYTE	C6	bb		reg[0] = long(signed byte bb)
LONGUBYTE	C7	bb		reg[0] = long(unsigned byte bb)
LONGWORD	C8	b1, b2		reg[0] = long(signed b1*256 + b2)
LONGUWORD	C9	b1, b2		reg[0] = long(unsigned b1*256 + b2)
LONGCON	CA	bb		reg[0] = long constant(nn)
SETOUT	D0	bb		Set OUT1 and OUT2 output pins
ADCMODE	D1	bb		Set A/D trigger mode
ADCTRIG	D2			A/D manual trigger
ADCSCALE	D3	ch		ADCscale[ch] = reg[0]
ADCLONG	D4	ch		reg[0] = ADCvalue[ch]
ADCLOAD	D5	ch		reg[0] = float(ADCvalue[ch]) * ADCscale[ch]
ADCWAIT	D6			wait for next A/D sample
TIMESSET	D7			time = reg[0]
TIMELONG	D8			reg[0] = time (long integer)
TICKLONG	D9			reg[0] = ticks (long integer)
EESAVE	DA	nn, ee		EEPROM[ee] = reg[nn]
EESAVEA	DB	ee		EEPROM[ee] = reg[A]
EELOAD	DC	nn, ee		reg[nn] = EEPROM[ee]
EELOADA	DD	ee		reg[A] = EEPROM[ee]
EEWRITE	DE	ee, bc, b1...bn		Store bytes starting at EEPROM[ee]
EXTSET	E0			external input count = reg[0]
EXTLONG	E1			reg[0] = external input counter
EXTWAIT	E2			wait for next external input
STRSET	E3	aa...00		Copy string to string buffer
STRSEL	E4	bb, bb		Set selection point
STRINS	E5	aa...00		Insert string at selection point
STRCMP	E6	aa...00		Compare string with string buffer
STRFIND	E7	aa...00		Find string and set selection point
STRFCHR	E8	aa...00		Set field separators
STRFIELD	E9	bb		Find field and set selection point
STRTOF	EA			Convert string selection to floating point
STRTOL	EB			Convert string selection to long integer
READSEL	EC		aa...00	Read string selection
SYNC	F0		5C	Get synchronization byte
READSTATUS	F1		ss	Read status byte

READSTR	F2		aa...00	Read string from string buffer
VERSION	F3			Copy version string to string buffer
IEEEMODE	F4			Set IEEE mode (default)
PICMODE	F5			Set PIC mode
CHECKSUM	F6			Calculate checksum for uM-FPU code
F_BREAK	F7			Debug breakpoint
TRACEOFF	F8			Turn debug trace off
TRACEON	F9			Turn debug trace on
TRACESTR	FA	aa...00		Send string to debug trace buffer
TRACEREG	FB	nn		Send register value to trace buffer
READVAR	FC	nn		Read internal register value
RESET	FF			Reset (9 consecutive FF bytes cause a reset, otherwise it is a NOP)

Notes:

Opcode	Opcode value in hexadecimal
Arguments	Additional data required by instruction
Returns	Data returned by instruction
nn	register number (0-127)
mm	register number (0-127)
fn	function number (0-63)
bb	8-bit value
b1,b2	16-bit value (b1 is MSB)
b1,b2,b3,b4	32-bit value (b1 is MSB)
b1...bn	string of 8-bit bytes
ss	Status byte
cc	Condition code
ee	EEPROM address slot (0-255)
ch	A/D channel number
bc	Byte count
t1...tn	String of 32-bit table values
aa...00	Zero terminated ASCII string

To avoid SX/B symbol conflicts some uM-FPU V3 instructions have an F_ prefix (e.g. F_CLR).

Appendix B


Floating Point Numbers

Floating point numbers can store both very large and very small values by “floating” the window of precision to fit the scale of the number. Fixed point numbers can’t handle very large or very small numbers and are prone to loss of precision when numbers are divided. The representation of floating point numbers used by the uM-FPU V3 is defined by the 32-bit IEEE 754 standard. The number of significant digits for a 32-bit floating point number is slightly more than 7 digits, and the range of values that can be handled is approximately $\pm 10^{38.53}$.

32-bit IEEE 754 Floating Point Representation

IEEE 754 floating point numbers have three components: a sign, exponent, the mantissa. The sign indicates whether the number is positive or negative. The exponent has an implied base of two and a bias value. The mantissa represents the fractional part of the number.

The 32-bit IEEE 754 representation is as follows:



Sign Bit (bit 31)

The sign bit is 0 for a positive number and 1 for a negative number.

Exponent (bits 30-23)

The exponent field is an 8-bit field that stores the value of the exponent with a bias of 127 that allows it to represent both positive and negative exponents. For example, if the exponent field is 128, it represents an exponent of one ($128 - 127 = 1$). An exponent field of all zeroes is used for denormalized numbers and an exponent field of all ones is used for the special numbers +infinity, -infinity and Not-a-Number (described below).

Mantissa (bits 30-23)

The mantissa is a 23-bit field that stores the precision bits of the number. For normalized numbers there is an implied leading bit equal to one.

Special Values

Zero

A zero value is represented by an exponent of zero and a mantissa of zero. Note that +0 and -0 are distinct values although they compare as equal.

Denormalized

If an exponent is all zeros, but the mantissa is non-zero the value is a denormalized number.

Denormalized numbers are used to represent very small numbers and provide for an extended range and a graceful transition towards zero on underflows. Note: The uM-FPU does not support operations

using denormalized numbers.

Infinity

The values +infinity and -infinity are denoted with an exponent of all ones and a fraction of all zeroes. The sign bit distinguishes between +infinity and -infinity. This allows operations to continue past an overflow. A nonzero number divided by zero will result in an infinity value.

Not A Number (NaN)

The value NaN is used to represent a value that does not represent a real number. An operation such as zero divided by zero will result in a value of NaN. The NaN value will flow through any mathematical operation. Note: The uM-FPU initializes all of its registers to NaN at reset, therefore any operation that uses a register that has not been previously set with a value will produce a result of NaN.

Some examples of 32-bit IEEE 754 floating point values displayed as SX/B hex values are as follows:

\$00, \$00, \$00, \$00	' 0.0
\$3D, \$CC, \$CC, \$CD	' 0.1
\$3F, \$00, \$00, \$00	' 0.5
\$3F, \$40, \$00, \$00	' 0.75
\$3F, \$7F, \$F9, \$72	' 0.9999
\$3F, \$80, \$00, \$00	' 1.0
\$40, \$00, \$00, \$00	' 2.0
\$40, \$2D, \$F8, \$54	' 2.7182818 (e)
\$40, \$49, \$0F, \$DB	' 3.1415927 (pi)
\$41, \$20, \$00, \$00	' 10.0
\$42, \$C8, \$00, \$00	' 100.0
\$44, \$7A, \$00, \$00	' 1000.0
\$44, \$9A, \$52, \$2B	' 1234.5678
\$49, \$74, \$24, \$00	' 1000000.0
\$80, \$00, \$00, \$00	' -0.0
\$BF, \$80, \$00, \$00	' -1.0
\$C1, \$20, \$00, \$00	' -10.0
\$C2, \$C8, \$00, \$00	' -100.0
\$7F, \$C0, \$00, \$00	' NaN (Not-a-Number)
\$7F, \$80, \$00, \$00	' +inf
\$FF, \$80, \$00, \$00	' -inf